



Issue: Correct Ball Joint Installation Orientation to Ensure Grease Fitting Accessibility

Brand	TTX	Product	Ball Joint	Date	September 2020
Part Number(s)	TXMS50580				

For applications associated with this part number and which feature the OEM stamped steel front lower control arm, this ball joint must be correctly orientated during installation to ensure adequate access to grease fitting.

The ball joint must be installed with the grease fitting facing front of vehicle. This will ensure sufficient clearance for any future lubrication service. **See Figure 1.**

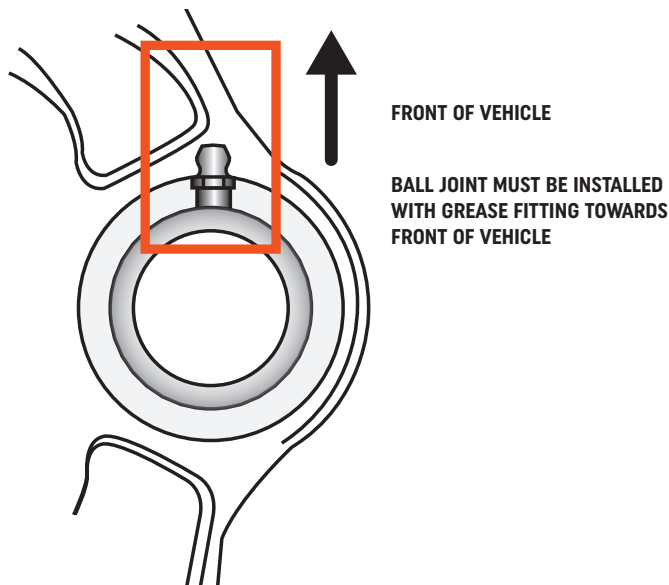


Figure 1: Correct Ball Joint Installation Orientation

