MEVOTECH

MEVOTECH INSIDER

Service Tips and Best Practices

2017-2010 Chevrolet Equinox and GMC Terrain Front Lower Control Arm Compliance Bushing Bracket Nut

Brand	TTX/Supreme/Original Grade	Product	Control Arm	Date	November 2021
Part Number(s)	CTXMS50117/CTXMS50118/MS50117/MS50118/GS50117/GS50118				

When ordering Mevotech replacement front lower controls with the above-referenced part numbers for the vehicle applications listed below, it is important for the Professional Technician to note that the compliance bushing bracket nut is not pre-torqued out of the box.

This nut is provided loose, so the bushing bracket can be more easily manipulated during installation of the control arm (**see Figure 1**). It will require final fastening with the proper torque value and suspension loaded to the correct ride height.

Application(s)
2017-2010 Chevrolet Equinox
2017-2010 GMC Terrain

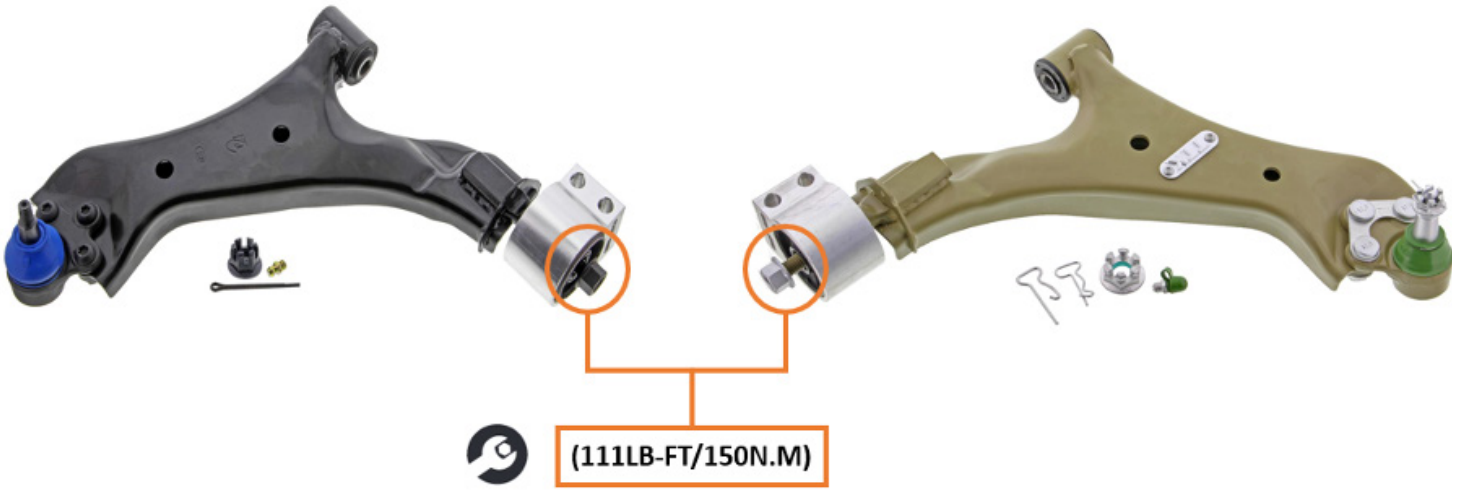


Figure 1. Bushing bracket nut (circled above) must be correctly torqued after fitting control arm to vehicle

Always refer to the factory service manual for correct diagnostic procedures, component removal and installation methods, as well as fastening torque values and procedures where applicable. Only use a calibrated torque wrench for final fastening.

WE SUPPORT ASE CERTIFICATION

DISCLAIMER: The information in this communication is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain vehicles. Refer to original manufacturers service manual for proper torque specifications and removal/installation procedures. All content in the publication is provided as-is and without warranty. All care has been taken to ensure the accuracy of the information presented. The publisher assumes no responsibility or liability for any loss or damage, direct, indirect or consequential, arising from the use of the information contained herein.