TECHNICAL SERVICE BULLETIN

Caster Change on Early Production Chrysler 300 & Dodge Challenger/Charger/Magnum Front Upper Control Arms

Issue: Replacement of Left and Right Control Arm at Same Time to Ensure Proper Alignment

Brand	Supreme & TTX	Product	Control Arms	Date	June 2020
Part Number(s)	CMS25117/CMS25118 & CTXMS25117/CTXMS25518				


On early production models of the Chrysler 300 and Dodge Challenger/Charger/Magnum, FCA implemented a running design change on the front upper control arms.

This OE running design change is characterized by a revised caster setting for the front wheels. It is important to note that the caster setting variation is approximately 2°.

When ordering replacement arms for these early production models, it is critical that both Front Upper Left and Right are replaced simultaneously.

Do not mix the early production control arm design with the updated version. Mixing the design types may cause vehicle tracking issues, excessive tire wear and premature failure of the part.

After vehicle repair, perform alignment.

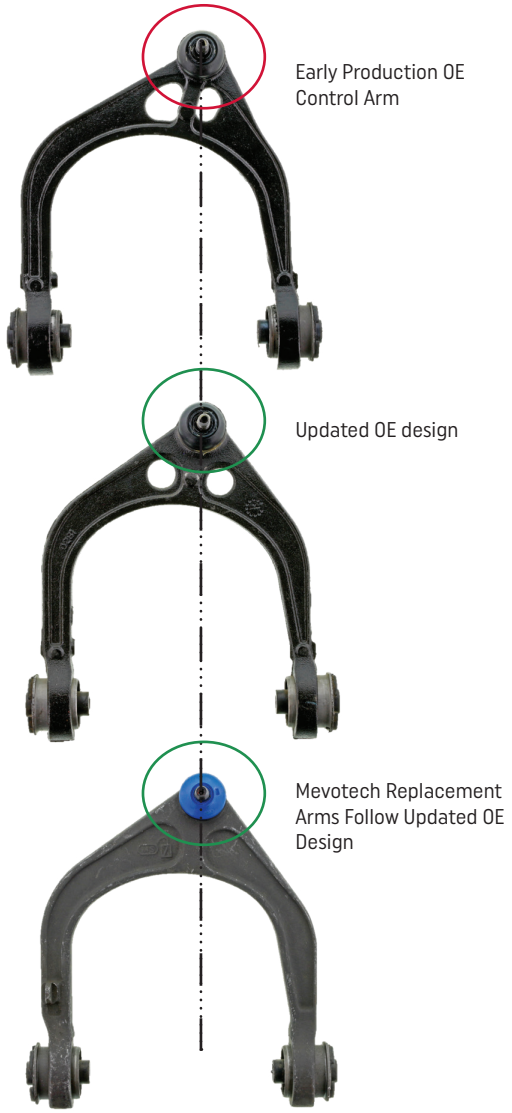

Early Production Model and Years

Make	Model	Year
Chrysler	300	2005-2008
Dodge	Challenger	2008-2009
	Charger	2006-2008
	Magnum	2005-2008

WE SUPPORT ASE CERTIFICATION

DISCLAIMER: The information in this communication is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain vehicles. Refer to original manufacturers service manual for proper torque specifications and removal/installation procedures. All content in the publication is provided as-is and without warranty. All care has been taken to ensure the accuracy of the information presented. The publisher assumes no responsibility or liability for any loss or damage, direct, indirect or consequential, arising from the use of the information contained herein.