



## Major Design Improvement: 2005-2000 Ford Super Duty Truck & SUV Front Stabilizer Bar Links


Brand	Supreme	Product	Stabilizer Bar Link	Date	July 2021
<b>Part Number(s)</b>	MS40805/MS40806				

The OEM (PNs: 1C3Z5K483BB/1C3Z5K483BA/MEF205/MEF206) and other OE-style front stabilizer bar links for the applications below utilize a non-greaseable plastic bearing and a 3-piece design, wherein the bushing housings are welded to the shaft rod.

### Application(s)

- 2005-2000 Ford Excursion
- 2004-2000 Ford F-250 Super Duty
- 2004-2000 Ford F-350 Super Duty
- 2004-2000 Ford F-450 Super Duty
- 2004-2000 Ford F-550 Super Duty

Mevotech Supreme front stabilizer bar links MS40805 and MS40806 are engineered with an improved solid steel 1-piece forging. This adds rigidity and strength to the assembly and reduces flex and cycling while the vehicle is in motion. The bushings have been converted to a ball and socket design, which is characterized by greaseable, self-lubricating lower sintered metal bearings for extended part service life and increased heat resistance. Additionally, an increased ball pin diameter optimizes pressure distribution. New hardware is included for a complete install. **See Figure 1.**

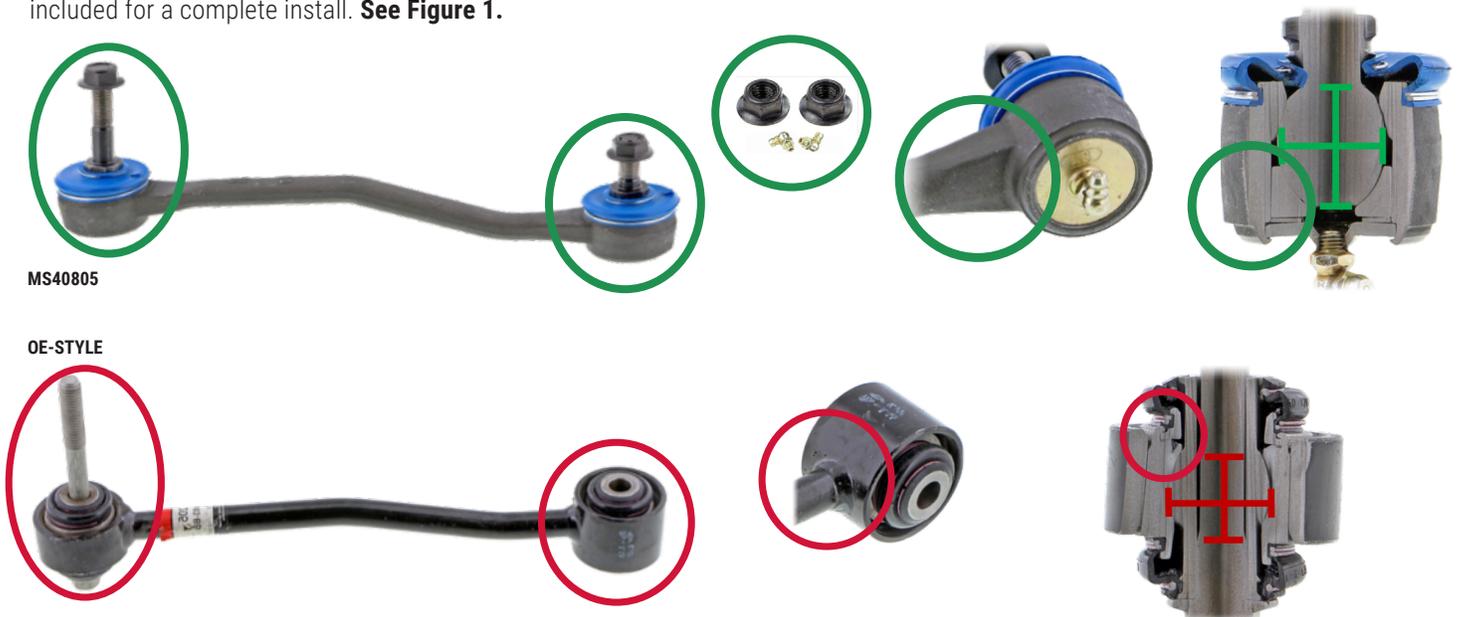

**Figure 1.** Mevotech Supreme front stabilizer link MS40805 with solid steel 1-piece forging and integrated ball joints, featuring greaseable, self-lubricating lower sintered metal bearing, increased ball pin to bearing contact area and included hardware (top) vs OEM with bushings design, sealed plastic bearing, welded connection and reduced ball pin contact area (bottom)

Technical Support Hotline: [1.844.383.7268](tel:1.844.383.7268)

For parts go to: [mevotech.com](http://mevotech.com)

Publication Number: [MXF-21-120-01-01-E](#)



WE SUPPORT  
ASE CERTIFICATION

DISCLAIMER: The information in this communication is intended for use only by skilled technicians who have the proper tools, equipment and training to correctly and safely maintain vehicles. Refer to original manufacturers service manual for proper torque specifications and removal/installation procedures. All content in the publication is provided as-is and without warranty. All care has been taken to ensure the accuracy of the information presented. The publisher assumes no responsibility or liability for any loss or damage, direct, indirect or consequential, arising from the use of the information contained herein.